



EXD Extruder Drive Speed Control Module EXL Line Speed Control Module



The Gravitrol® System: complete gravimetric extrusion control via drive speed control and line speed control (Pictured above is an EXL card with pulse generator and encoder)

Process Control's Gravitrol® Gravimetric Extrusion Control Systems automates the control of any extrusion line – coextrusion or monoextrusion – on the basis of weight.

A standard system has an HG Series Weigh Hopper mounted on each extruder to measure the extruder's weight throughput. The weigh hopper reports the measurement to an EXB central computer, which controls the extruder drive and/or take-off device drive. Alternatively, Process Control X Series and Guardian® blenders can monitor extruder throughput and control the extruder drive and take-off device. In both cases, the EXD Extruder Drive Control Module and the EXL

Line Speed Control Module provide the interface for this communication.

The EXD Extruder Drive Speed Control circuit board is mounted on an L-bracket, that is designed for easy mounting in your existing drive cabinet. It can also be supplied in a stand-alone enclosure for remote mounting.

The EXL Line Speed Control Module consists of a circuit board on an L-bracket like the EXD Module. It also includes a pulse generator with encoder that accurately measures line speed for closed-loop control.

The EXD and EXL cards receive digital signals from the Gravitrol® central computer and send analog

speed reference signals to the drives. This signal can be either 0-10 VDC or 4-20 mA, and should be specified when the system is ordered. These boards are custom-designed, programmed, and tested in-house by Process Control engineers.

Sophisticated programming allows the system to ramp all drives synchronously. This enables the Gravitrol® system to make smooth transitions from the current line output to a new target output while maintaining product integrity.

The EXD and EXL modules are designed for easy integration into a conventional extrusion control design with existing manual potentiometers or digital speed controls. The modules feature inputs for the manual speed control signals allow operators to use existing manual controls when required. The system is switched from manual to automatic (Gravitrol®) control through a single MANUAL/GRAVITROL® switch (available separately).

Gravitrol® also provides a computer-controlled manual mode that allows the operator to digitally set the speed of each extruder and/or line speed. This mode is normally used for line start-up. ■


Standard Features

- L-bracket design for cabinet mounting
- 0-10VDC or 4-20mA speed reference signal available
- Manual potentiometer inputs provided for fail-safe backup

Also Available

- Stand-alone enclosure for remote mounting

Gravitrol® Line and Drive Speed Control Modules

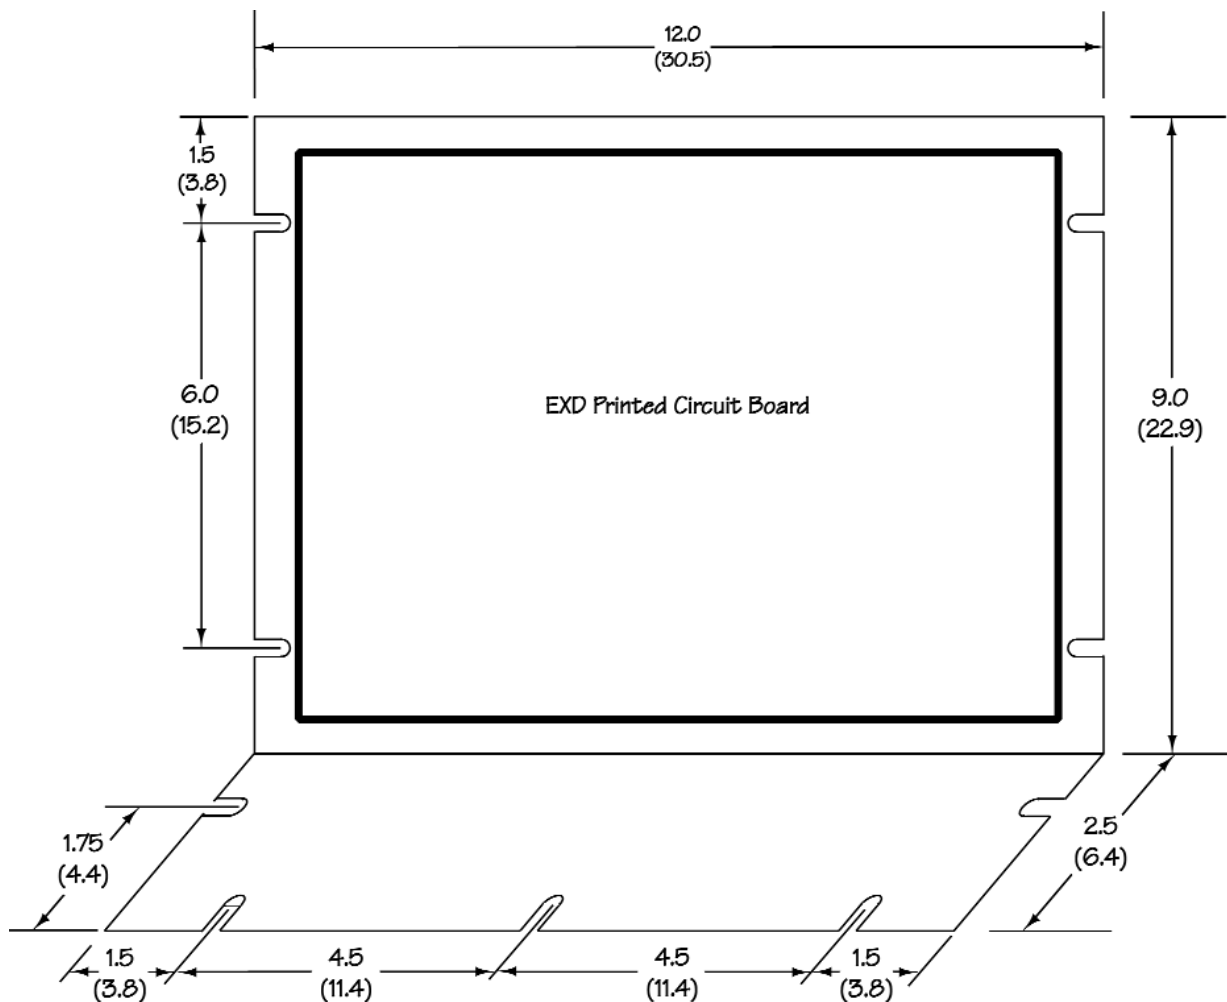

Bottom section of L-bracket is at 90° angle to printed circuit board mounting surface section.
 EXD printed circuit board detail omitted for clarity. Every unit is factory tested before shipment.
 Information is subject to change without notice. Use only certified drawings for construction purposes.

() dimensions are in mm



PROCESS CONTROL Corporation
 World Headquarters
 6875 Mimms Drive, Atlanta, GA 30340 USA
 Tel: (770) 449-8810 Fax: (770) 449-5445
 www.process-control.com

Process Control China Limited
 Guangzhou, Guangdong Province, China
 TEL: +8620 28395688 FAX: +8620 28395773

Process Control GmbH
 Birstein, Germany
 TEL: +49-6054-91 29-0 FAX: +49-6054-91 29-99